



# 2000 Series Central/Medium-Duty Granulators


*Airveyor discharge provides continuous material evacuation.*



*Twinshear™ knife configuration increases cutting efficiency*



*A drop down screen cradle provides quick screen access for simplified maintenance.*

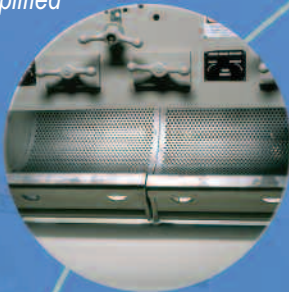

*Hydraulic tilt mechanism for the infeed hopper provides complete access to the cutting chamber and rotor.*



*Low feed height and large widths are ideal for thermoforming.*



**Model 2042**

# 2000 Series Central/Medium-Duty Granulators

## Standard Features

- Hand-feed hopper, double-wall construction, 70" feed height
- Offset cutting chamber, 2 TwinShear bed knives, top access: single edge, HCHC
- 3-knife TwinShear, steep angle rotor with extended shaft for optional flywheel
- Steep angle, 55 degree, landed HCHC rotor knives
- 75 HP, V belt drive, 450 RPM
- 8" airveyor discharge chute (10" on Model 2062)

Model	Cutting Chamber Size	Throughput
2042	20" x 42"	1800 lbs./hr.
2050	20" x 50"	2200 lbs./hr.
2062	20" x 62"	2600 lbs./hr.

## Options

- Feed roll/paddle wheel, sheet feed or side feed
- Modular conveyor feed add-on chute: 88" feed height
- Wear-resistant cutting chamber and rotor
- 3 knife high shear, 5 knife steep angle, or 5 knife high shear rotor (all TwinShear)
- Steep angle, keen edge HCHC high shear, HCHC rotor knives
- Sound enclosure
- 50 HP, 60 HP, 100 HP motor
- 10" airveyor discharge chute
- Dual flywheel drive
- Variety of screen sizes available
- NEMA 12, 110 Volt controls with safety interlocks. Free standing control panel with 460V service
- Other voltages
- #8 or #10 Floor mtg. blower, cyclone, cyclone stand, infeed conveyor



### CORPORATE HEADQUARTERS

2900 S. 160th Street  
New Berlin, WI 53151  
TEL: (262) 641-8600  
FAX: (262) 641-8653

[www.cumberland-plastics.com](http://www.cumberland-plastics.com)

### REGIONAL SERVICE CENTERS (800) 229-2919

ACS Tech Center  
4100 Market Place  
Flint, MI 48507  
TEL: (810) 720-7300  
FAX: (810) 720-2598

ALL DATA SUBJECT TO CHANGE WITHOUT NOTICE

©2010 Cumberland Engineering

Bulletin CD2-921.2